

QX7 APPLICATION GUIDELINE 1.2

Unlocking VI/II Input Rev. 3

Introduction

This feature allows you to correct a glitch when the QX7 drive is not responding to VI/II input signal. This should be used on drives prior to Rev. 4. (See software revision document).

Programming

Keystroke	LED Display
Press Setup/program/monitor key	Setup
Press Setup/program/monitor key	Program Search
Down arrow 11 times	Program Input Terminals
Read/Write	F Terminal Forward (NO)
Up arrow 6 times	S3 Terminal Set Speed 3 (NO)
Read/Write	S3 Terminal *Flashing* Set Speed 3 (NO)
Down arrow 14 times	S3 Terminal *Flashing* Unassigned (NO)
Read/Write	S3 Terminal Unassigned (NO)
Setup/Program/Monitor 3 times	Output Frequency 0.0Hz

Notes

Re-check to assure all parameters are set properly.

For additional assistance, please contact Toshiba Adjustable Speed Drive Marketing Dept. at (800) 872-2192